

# SERVICING DEALERSHIP TEXAS KENNORTH CO. LLC. GRA

MHC KENWORTH - FORT WORTH 2520 BERNER FORT WORTH, TX 76111 1-817-740-2300

### REQUEST FOR PO

Customer Number:		Phone:	Council of the Counci		R. O. Number:	
Tax Status	erms	P.O.#		i I	Service Date	Date Printed
TAX C	HARGE	REQUIRED			4/27/2023	5/09/2023

## REQUEST FOR PO

Serial Number		Whit Num	ber 🕥	77.54	Make / N	lodel	Year	License Nun	nber	Mileage
1XPTP4TX2ED226	8838	( TP:	23 /	S. 14.887	PB/389	1	2014			42004
OPERATION 2		_	$\mathcal{I}$							
COMPLAINT: VMRS CODE: CORRECTION:	O1-99 INSPECTED AND A FAULT REMOVE TROUGH SENSO ENGIN LIGHT ON PT COME	99-999-9 ECT-TOTA KED FAUL AMBIENT F AND DE VED DASH BLESHOT NE OIL P F FLICKE FO AND E	L VEHIC TS AND AIR TERMINI PANEL AMBIEN NG INC RESSUR RING AI NGINE I	CLE-TOT. FOUND MPERATU ED UNIT S FOR A T AIR T ORRECTL E SENSO ND FOUN BLOCK I OUBLESH	ACTIVE COL RE ERRATIO IS IN NEE CCESS TO MEMPERATURE Y. DURING R LEAKING D PTO LIGH N NUMEROUS DOTING NOT	DES FOI C. TRO C. TRO INTROUB TROUB OIL. IT WIR PLACE FED FRO	R DPF A OUBLESH DPF CLE HARNES I AND D LESHOOT TROUBLE ING RUB ES, CAU	SH LOADING T ASH LOA ANING. SI ETERMINED ING, NOTEI SHOT PTO BED THROUG SING LIGHT R HOUSING	OAT O SH T TO AND	0.00 0.00
COMPLAINT: VMRS CODE: CORRECTION:	01-99 INSPEREDLA	99-999-9 ECT-TOTA ACED PTO	99-06-0 L VEHIC HARNES	CLE-TOT	SECURED IN LEAK AT F	'. LIGI	HT NO L	ONGER	62	5.00
91200IMP 1-1618DSP			PTC UN: NECTOR-	I ON -STP DW	N	1		2 .31 2 .63		2.31
OPERATION 4					Tot		arts To eration			9.94
COMPLAINT: VMRS CODE:				12	de de la composición del composición de la composición de la composición del composición de la composición del composición de la composición de la composición del composici					
						A second of the	The state of the s			

CONTINUED



# SERVICING DEALERSHIP TEXAS KENWORTH CO, LLC, DBA

MHC KENWORTH - FORT WORTH 2520 BERNER FORT WORTH, TX 76111 1-817-740-2300

### REQUEST FOR PO

Customer Numl	ber:	Phone:	R. O. Number:	
Tax Status	Terms	P.O.#	Service Date	Date Printed
TAX	CHARGE	REQUIRED	4/27/2023	5/09/2023

		CHARGE I RE	-QUINED			4/2/12	.023	5/09/2023
	20 40 						THE SECTION	
	OPERATION 4							
	CORRECTION	DEDIACE SITE						
	CORRECTION:	REPLACE WIT	H NEW-DEE E	TTTER - L	TESEL P.	ARTICULATE	EXHAUS	T-
		REMOVED DPF	TER-TREATMEN	NI DEVICE	S-BROKE	N A TOP		
	ě.	TAGGED. NEE	ns hor prot	VCED IN	CTALLED	NEW DDE	NO OLD D	00
	£ *	COMPLETED D	PE MATNTENAL	NCE PROCE	DURE ON	CUMMINS	NO DAN A	JC.
		COMPLETED D	LETED REGEN	NO FAUL	TS ACTI	JE AFTER F	EPATRS	
			4.	.U Hour	S	Labor Tot	al	1.000.00
	270640							
	3/9640	BO	OT .		1 11 1	33	.20	33.20
	RE33/3034	0 511	NGLE JUB OR.	ING KIT		110	.92	10.92
	286633700	M CV	SKEL-EARVIIG	L PHIEKDI	11 1	116	. bZ	118.62
	5579295CU	M KT	r. PARTICULAT	re ett. Ter	†	3 66	140	3 667 40
					1-1-1-1	Parts Tot	åi	3,007.49
		BO SI 4 RE M GA M KI			Total (	peration	T4	4.849.55
	OPERATION 5							-,
	COMPLATIM.	D /D OTT DOD			A A	机铁盐油管	ALL TO THE STATE OF	
	UMPS CODE:	R/R OIL PRE: 01-003-001-	SORE SENSOR	3				
	CORRECTION	REPLACE WITH	JU4-U3-12 J NEW-CENDIN	IC IINITE		OTT DDDGG	TIPE ONTO	
-	CORRECTION.	& WARNING	DEVICES-BROK	KEN NG ONII -	FINGTINE	OIL PRESS	UKE-GAUG	25
		REPLACED OI	PRESSURE	SENSOR. A	ND CLEAR	JED OFF PT	,iic	
				5 Hour	s	Labor Tot	ăi	125.00
								220.00
	492151700	M SEI	ISOR-PRESSUE	XE	1	157	.42	157.42
=	KF1135300	PEI	VETRANT CLEA	ANER AND	<del>-</del>	D 4	.33	4.33
					Total (	peration	d:	161./5
	4921517CU RF1135300 OPERATION 7				****			200.75
	COMPLAINT:	RESEAL GEAR	HOUSING AND	OIL PAN	5- in 141			
- 1	COPPECTION:	01-045-008-0 REPLACE WITH	1 NEM CONCID	TIME CANACIT	N			
- 1	CORRECTION.	VALVE MECH	ANISM-BROKEN	if I—Camsh	Arı – Ac	CESSURY D	KIAE &	
		RECOVERED AC	AND DRATHE	D OTT. AN	D COOLAN	T PEMOVE	ייי א דע אם	)D
- 1		SHROUD, AND	FAN. REMOVE	D VIBRAT	TON DAME	FR. CRANK	CASE FIL	rep
l	•	ASSI, AND BE	KAUKET. REMU	)VED FUEL	SUPPLY	LINE: OTI	FILLT	3E.
		WALKE COMED	AND DOCKET		HE TAIMS	TIME DOOTING	SOMETHING OF THE	
		ALONG WITH C INSPECTED BE GEAR COVER A MOUNT AND GE AND MATTING	AMSHAFT. RE	MOVED OI	L PAN AN	ID_2_MAIN	CAPS.	
- 1		INSPECTED BE	ARINGS, NEE	D NEW MA	TN WND F	OD BEARIN	GS. REMOV	/ED
- 1		MOUNT AND CE	IND GEARS, I	NOTECTED	AND THE	DECTED CE	ED ENGINE	30
ı								
- 1		AND REMOVED	ENGINE FROM	STAND.	INSTALLE	D ENGINE	MOUNT ST	FEAM
1		AND REMOVED CLEANED OIL	PAN. INSTAI	LED SCIS	SOR GEAR	. SCISSOR	IDLER G	AR.
1		AND CAM IDLE	R GEAR. REP	LACED MA	IN BEARI	NGS. CHEC	KED	,
1		AND CAM IDLE CRANKSHAFT E	ND PLAY. RE	PLACED R	DD BEARI	NGS. VERI	FIED SIDE	E
		CLEARANCE OF	EACH ROD.	INSTALLE	DEBLOCK	STIFFENER	PIATE (	)IL
		PICKUP, AND INSTALLED FR	OLD PAN. RE	THACED D	AMAGED F	OCKER LEV	EK,	
l		LASH. INSTAL	LED GEAR CO	VER AND	SENSOR A	DYDALD I	MODALIED	
- 1		LASH. INSTAI	MPER, ROCKE	R LEVERS	AND SE	T OVERHEA	D. REPLAC	ED
- 1		VALVE COVER	GASKET AND	INSTALLE	VALVE	COVER. IN	STALLED I	AN
1					·美田学6章 "主		#94871 - 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	

CONTINUED



### REQUEST FOR PO

# SERVICING DEALERSHIP TEXAS KENWORTH CO. LLC, DBA

MHC KENWORTH - FORT WORTH 2520 BERNER FORT WORTH, TX 76111 1-817-740-2300

Tax Status Terms	P.O.#	Service Date Date Printed
TAX CHAP	RGE REQUIRED	4/27/2023 5/09/2023

- AND					
OPERATION 7					
	HUB, BELTS BRACKET, A VACUUMED AI HARNESSES. THROUGH. II AND ASSY.	, FAN, SHROUD, AND F LTERNATOR, AND AC CO ND CHARGED AC. CONNE REPLACED SURGE TANK NSTALLED TRANS COOLE FILLED COOLANT AND C 34.3 Hou	ADIATOR MPRESSO CTED RA HOSE, R, CRAN IL. REI	R. INSTALLED A DR. REPLACED A ADIATOR PLUMBI FOUND IT WAS NKCASE FILTER PLACED OIL FIL Labor Total	CCESSORY C DRYER. NG AND RUBBED BRACKET TER 8,575.00
2871453CUN 2866337CUN 2866633CUN 4921517CUN 75971IMP 71386IMP 711668IMP 5440813CUN 4299751CUN 3687051CUN 3687051CUN 3688113CUN 3687051CUN 4299124CUN 4393089CUN 4393089CUN 4374074CUN 4393089CUN 4374074CUN 4393089CUN 4374074CUN 4393089CUN 4374074CUN 4393089CUN 5414000NNF MAJ15W402G 3104392CUM RF1135298 6676110CUM 28820873CUM 28820873CUM 5406110CUM 64298629CUM 5406110CUM 65406110CUM 65	GA G	ASKET-AFM DEVICE ASKET-EXHAUST 5" ASKET-EXHAUST 5" ASKET-EXHAUST CIRCUL ENSOR-PRESSURE OOM 1/4 BOX IP TIE SM UV RESISTA APE-ELECT RICAL 3/4 ASKET-ACC DRIVE SUPP ASKET, CAMSHAFT COVE EAL-O RING ARRIER, SE. LUG-GEAR COVER EAL, RECTA. ASKET EAL, RECTA. ASKET EAL, RECTANGULAR RIN EAL, O RIN. ASKET-GEAR HOUSING EAL-OIL CREW, TWELVE POINT CA ASKET-ADAPTER ASKET-OIL PAN ILTER 5W40 IN TWO GALLON J ASKET, VAL. RAKE CLEANER NON-CHL RC CONTACT CLEANER ILCONE LOCTITE 569 DOLANT RED HD ELC AMSHAFT ET-MAIN BEARING ET-ROD BEA	A NXOR G P J R 95	32 64.33 64.33 19.74 157.49 157.49 157.49 157.49 157.49 157.49 157.49 157.49 157.49 157.49 157.49 157.49 157.49 157.49 167.49 167.49 173.60	193.02 38.446 157.420 51.420 551.420 8.533.8740 8.533.8740 67.5
OPERATION 8			4条。		
COMPLAINT: 1 VMRS CODE:	REPLACE MIR 01-002-010-	RROR HARNESS -056-03-12			

CONTINUED



SERVICING DEALERSHIP
TEXAS KENWORTH COULC, DBA
MHC KENWORTH - FORT WORTH
2520 BERNER
FORT WORTH, TX 76111
1-817-740-2300

#### REQUEST FOR PO

Customer Num	nber:	Phone:	R. O.:Nûmber:
Tax Status	Terms	P.O.#	Service Date
TAX	CHARGE	REQUIRED	4/27/2023 5/09/2023
		#1 <b>00</b>	

OPERATION 8		
CORRECTION: REPLACE BROKEN	WITH NEW-WIRING HARNESS - POWER MIRROR-MIRRORS	-
REPLACED	HARNESS ON DRIVER SIDE MIRROR FOR OAT SENSOR. D PANELS BACK ON DASH.	
	2.5 Hours Labor Total	625.00
P92-4022-11121180 FREIGHT	HARNESS-MIRROR 1 550 93 CHARGE FREIGHT 1 95.00	550.93 95.00
	Parts Total Total Operation 8	1,270.93

CONTINUED



## REQUEST FOR PO

**Customer Number:** 

SERVICING DEALERSHIP

TEXAS KENWORTH CO. LLC, DBA

MHC KENWORTH - FORT WORTH 2520 BERNER FORT WORTH, TX 76111 1-817-740-2300

R. O. Number:

Phone:

MHC IS CERTIFIED FOR CATERPILLAR, CUMMINS AND MX OVERHAULS/WARRANTY REPAIRS

MHC OFFERS PARTS AND SERVICE FOR ALL MAKES OF TRUCK

Labor Total Parts Total Shop Supplies Sales Tax Freight				11,450.00 10,646.151 1,374.001 999.50 95.001
		William Control of the Control of th		95.00
	And the second s	The second secon	Andrews and Anthrope Control of the	
	The state of the s	AND CONTROL OF THE CO		

**TOTAL DUE** 

24,564.65

REMIT TO:

P.O. BOX 879269 KANSAS CITY, MO 64187-9269



WELLER









HENDRICKSON Genuine Parts J 0 5 1

**№ BorgWarner** 

• ROADFORCE •

